

Technical Bulletin


Date Released:	12-11-2015	Tracking Number:	TBACE2-002
Document Revision:	REV A		
Date Revised:		Written By:	Brian Woods
Model/Part No.:	ACM135 / ACM150		

Re: E2 code on thermostat with new installation

Details: Our ACM135 / ACM150 require 8 wires between the thermostat and the upper unit. Some aftermarket installations may have fewer wires than this requirement and additional wires must be run. Some dealers, upon initial installation, may see “E2” displayed on the thermostat.

This can occur in the following situations:

- Freeze Control is not connected between the relay kit and the sensor.
- The PURPLE wire is disconnected between the relay kit and the thermostat.

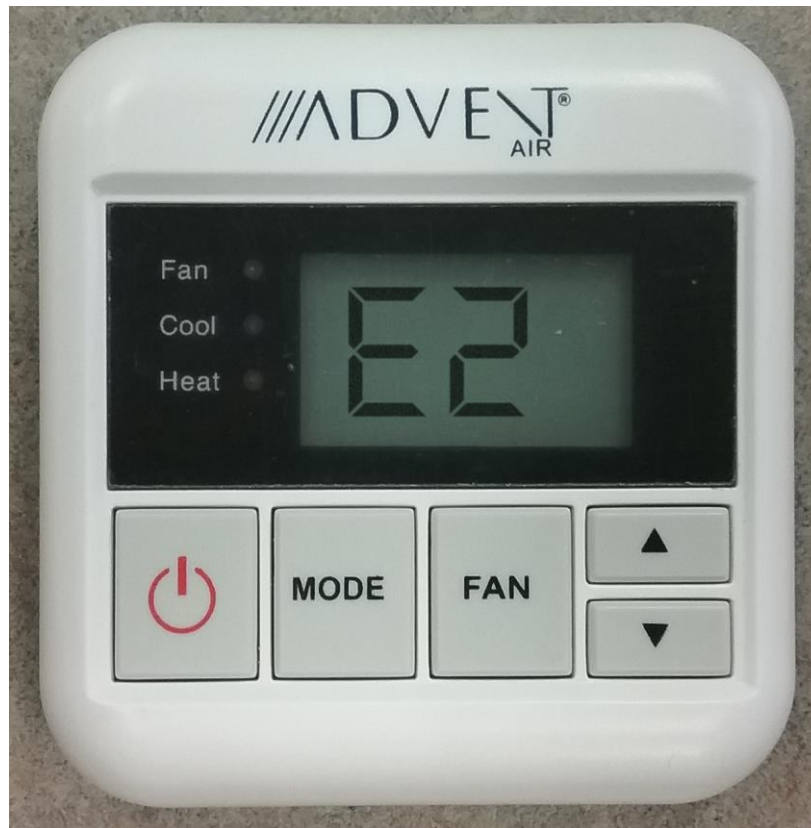

Note: All 8 wires must be used between the thermostat and the upper unit for correct operation.